









CITROEN



 Code	
<b>O-9</b>	
108C	382
109/5	384
109/5E	384
109/5F	384
109K	384
129/5	384
150A	390
150B (XY8)	390
150C	390
150D	390
150D (XY7)	390
150F	390
1580 SPI	400
159A	412
161 (XUD7)	404
161A (XUD7)	404
162 (XUD9)	414
170A (XN1T)	426
170B (XN1T)	426
170C (XN1T)	426
171A	394
171B	394
171C	394
171D	394
180A (XU5J)	400
180Z	394
1KR-FE	380
220 A2.000	400
3FZ (EW12J4)	430
4HT (DW12BTED4)	430
4HU	430
4HV	430
4HW (DW12TED4)	428
4HX (DW12TED4)	428
5FR (EP6DT)	396
5FS (EP6C)	400
5FT (EP6DT)	396
5FU (EP6DTS)	396
5FV (EP6CDT)	400
5FV (EP6DT)	396
5FW (EP6)	400
5FX (EP6DT)	396
6FY (EW7A)	406
6FZ (EW7J4)	406
8140.43N	434
8140.43S	434
8FS (EP3)	392
8HR (DV4C)	392
8HX (DV4TD)	386
8HY (DV4TED4)	392
9HT (DV6BTED4)	396
9HT (DV6BUTED4)	396
9HX (DV6ATED4)	396
9HY (DV6TED4)	396, 402
9HZ (DV6TED4)	396
<b>A</b>	
A06/635	380
A06/664	380
A 53	380
A79/1 (AYA2)	380
A8A (XUD7TE)	402
A9A (XUD7)	404
AJZ (XUD7TE)	402



 Code	
<b>B</b>	
B1A (XU51C/K)	394
B1E (XU51C)	394
B6D	394
B6E	394
BAY (XU5CP)	394
BAZ (XU5CP)	394
BDY (XU5M)	394
BDZ (XU5M)	394
BFZ (XU5JP)	394
<b>C</b>	
C1A	380
C3A	380
CDY (TU9M)	380
CDZ (TU9M)	380
CRD93L (U25-661)	430
CRD93LS (U25-673)	432
<b>D</b>	
D2A (XU92C)	412
D2C (XU92C)	410-412
D2F	410
D6A (XU9J2)	412
D6C (XU9J4)	408
D6E (XU9JA)	412
D8B (XUD9TF)	408
D8C (XUD9TF)	408
D9A (XUD9)	414
D9B (XUD9A/L)	410
D9B (XUD9A/U)	410
DDZ (XU9M)	406
DFW (XU9J4)	408
DFZ (XU9J1)	408
DHV (XUD9BSSD)	408
DHW (XUD9SD)	408
DHX (XUD91F/BTF)	408
DHY (XUD9TE/Y)	408
DJY (XUD9A)	410
DJZ (XUD9Y)	410
DKZ (XU9JA)	410
DT17ED4	434
DT20C	436
DV4D	386
DV4TD	386
DV6ATED4	396
DV6B	396
DV6C	396
DV6TED4	396
DW10ATED (RHZ)	414
DW10BTED (RHX)	414
DW10BTED4	416
DW10TD	416
DW10TD/ATED (RHZ/RHY)	414
DW10UTD	416
DW12TED	428
DW12TED4 (4HX)	428
DW8B	412
<b>E</b>	
EP6DT	396
ES9J4S	436
EW10A	416
EW10J4 (RFN)	418
EW10J4S	418



 Code	
<b>F</b>	
F28TDCR	434
<b>G</b>	
G1A	384
<b>H</b>	
H1A	382
H1B	382
HAZ (TU1CP)	382
HDY	382
HDZ (TU1M+)	382
HFX (TU1JP)	382
<b>K</b>	
K1B	386
K1F	386
K1G	386
K1H (TU3A)	386
K2A	386
K2B	386
K2D	386
K3A	386
K9A (TUD3)	390
K9Y (TUD3Y)	390
KAY (TU3CP)	386
KAZ	386
KDX (TU3M/Z)	386
KDY (TU3FM)	386
KDY (TU3M)	386
KDZ (TU3M/Z)	386
KFU (ET3J4)	388
KFV (TU3JP)	388
KFW (TU3JP)	388
KFX (TU3JP)	388
KFY (TU3FJ2)	390
KFZ (TU3FJ2)	390
<b>L</b>	
LFX (XU7JB)	404
LFY (XU7JP4)	404
LFZ (XU7JP)	406
<b>M</b>	
M25-629	430
M25-648	432
M25-659	430
M25-660	430
M25-662	432
M25-666	432
M25-667	432
M25-669	432
M28 (AM2)	380
M4A	384
<b>N</b>	
NFR (TU5JP4B)	398
NFS (TU5JP4S)	398
NFT	398
NFU (TU5JP4)	398
NFV (TU5JP)	398
NFX (TU5J4)	400
NFZ (TU5JP)	398
<b>P</b>	
P8A (XUD11ATE)	426



 Code	
P8C (XUD11BTE)	426
P9A (XUD11A)	428
PHZ (XUD11ATE)	426
PJZ (XUD11ATE)	426
<b>R</b>	
R6A	424
RDZ (XU10MZ)	418
RFJ (EW10A)	416
RFK (EW10J4S)	418
RFN (EW10J4)	418
RFS (XU10J4RS)	418
RFT (XU10J4/Z)	418
RFU (XU10J2/C)	420
RFV (XU10J4R)	420
RFW (XU10J2U)	420
RFX (XU10J2C)	420
RFY (XU10J2C/L3)	420
RFY (XU10J4/Z)	422
RFZ (XU10J2)	418
RGX (XU10J2TE)	422
RGY (XU10J2TE/Z)	422
RHJ (DW10BTED4)	416
RHK (DW10UTED4)	422
RHM (DW10ATED4)	424
RHR (DW10BTED4)	416
RHS (DW10ATED)	414
RHT (DW10ATED4)	424
RHW (DW10ATED4)	424
RHX	414
RHX (DW10BTED)	414
RHY (DW10TD)	414
RHZ (DW10ATED)	414
RLZ (EW10D)	424
<b>S</b>	
SFZ (ZPJ/Z)	436
SKZ (ZPJ4/Z)	438
<b>T</b>	
T8A (DJ5T)	432
T9A (DJ5)	432
THX (DJ5TED)	432
THY (DK5ATE)	432
THZ	432
TU1M (HDZ)	382
TU3JP	388
TU9	380
<b>U</b>	
UFZ (ZPJ/Z)	436
UHZ (DT17BTED4)	434
UKZ (ZPJ4/Z)	438
<b>V</b>	
VJY (TUD5)	394
VJZ (TUD5)	394
<b>W</b>	
WJY (DW8B)	412
WJZ (DW8)	412
<b>X</b>	
XFU (ES9A)	438
XFV (ES9A)	438
XFX (ES9J4S)	436, 440

CITROEN

 Code	
XFZ (ES9J4)	440
XU102C	418
XU102C (R2A)	426
XU10J2	424
XU52C	394
XV8	380

 Code	
--	---

 Code	
--	---

 Code	
--	---

CITROEN						
Ltr.						
0,4 A 53 A79/1 (AYA2)	12-17 kW (16-23 PS) DYANE 4 2 CV 4	03/63-12/75	<b>01-22561-02</b> 0197.51			
0,6 A06/635 A06/664 M28 (AM2)	20-24 kW (27-33 PS) ACADIANE 6 AMI 6 AMI 8 MEHARI 2 CV 6	05/68-07/90	<b>01-22561-02</b> 0197.51			
1,0 CDY (TU9M) CDZ (TU9M) C1A C3A	30-37 kW (41-50 PS) AX 10 SAXO	07/86-06/03	<b>02-31146-02</b> ⑫ ⑬ 0197.J0  <b>02-31195-01</b> ⑫ 0197.H8 +0209.89 <b>08-31859-01</b> ⑬ ⑬	<b>61-31195-00</b> 0209.89 73,5 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	
1,0 TU9	33 kW (45 PS) C15	10/84-12/97	<b>02-31146-01</b> ⑫ 0197.H8  <b>02-31195-01</b> ⑫ 0197.H8 +0209.89 <b>08-31859-01</b> ⑬ ⑬	<b>61-31195-00</b> 0209.89 73,5 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	
1,0 XV8	33 kW (45 PS) C15	10/84-12/97	<b>02-23307-02</b> ⑫ 0197.75  <b>08-23542-01</b> ⑬ ⑬	<b>61-23775-20</b> 0209.G8 76 Ø 1,2 mm Zentrierdurchm. 16 mm 	<b>61-27265-10</b> 0209.A6 76 Ø 1,3 mm Zentrierdurchm. 14 mm 	
1,0 1KR-FE	50 kW (68 PS) C1	06/05→	<b>01-53425-01</b> ⑫ ⑬ ⑭ 0197.AF <b>02-53425-01</b> ⑫ ⑭ 0197.AG	<b>61-53425-00</b> 0209.EC MLS 		

⑫ mit Zylinderlaufbuchsenringe / with cylinder liner rings / avec joints de chemises de cylindre / con anillos para camisa de cilindro / con anelli tenuta canna cilindro / с прокладками гильз цилиндров  
 ⑬ mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>71-22561-00</b> 75 516 398 	2x				
<b>71-22561-00</b> 75 516 398 	2x				
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19	8x	<b>71-38817-00</b> 	2x <b>71-31147-00</b> 0349.A6  <b>71-31862-00</b> 1709.10 	2x <b>70-31414-10</b> 
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19	8x	<b>71-38817-00</b> 	2x <b>71-31147-00</b> 0349.A6 	2x <b>70-31414-10</b> 
<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16 	<b>71-23542-30</b> 0304.46 
<b>71-53503-00</b> 0349.C9 	<b>12-53507-01</b> 0956.54 (12x)		<b>71-53504-00</b> 0348.S4 	<b>71-53506-00</b> 0349.L1 	<b>70-31414-10</b> 
					<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
					<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-40</b> K → 85x105x11 A SL LD FPM <b>81-34403-00</b> N 0236.44 36x50x7 A SL RD FPM
					<b>81-21798-30</b> K ← 0236.14 35x50x8 A SL WD ACM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM
					<b>81-53509-00</b> K → 8822.X0 74x89x8,5 A SL LD MVQ

⑬ Motorblockmaterial Grauguß / engine Block Material Grey Cast Iron / matériel pour bloc-moteur / material bloque motor Fonte grise / materiale blocco motore A getto di ghisa grigia / материал блока двигателя Серый чугун



CITROEN						
Ltr.						
1,0 108C	33 kW (45 PS) LNA VISA	07/84-06/88	<b>02-23307-01</b> ⑫ 0197.74 	<b>61-22970-10</b> 74 Ø 1,2 mm 		
1,1 HAZ (TU1CP) HDZ (TU1M+) H1A H1B TU1M (HDZ)	40-44 kW (54-60 PS) AX 11 BX 11 C15 ZX	09/86→	<b>02-31146-01</b> ⑫ 0197.H8  <b>02-31200-01</b> ⑫ ⑮ 0197.H8 +0209.CJ <b>08-33674-01</b> ⑬ ⑮	<b>61-33715-00</b> ⑮ 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	
1,1 HDY HDZ (TU1M+)	40-44 kW (54-60 PS) BERLINGO SAXO	05/96→	<b>02-31146-02</b> ⑫ ⑮ 0197.J0  <b>02-31195-01</b> ⑫ 0197.H8 +0209.89 <b>08-31859-01</b> ⑬ ⑮ 	<b>61-31195-00</b> 0209.89 73,5 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	
1,1 HDZ (TU1M+)	44 kW (60 PS) C15	08/88-07/96	<b>02-31146-02</b> ⑫ ⑮ 0197.J0  <b>02-31200-01</b> ⑫ ⑮ 0197.H8 +0209.CJ <b>08-33674-01</b> ⑬ ⑮	<b>61-33715-00</b> ⑮ 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	
1,1 HFX (TU1JP)	44 kW (60 PS) BERLINGO C2 C3 SAXO	05/96→	<b>02-35060-01</b> ⑫ <b>08-31859-02</b> ⑬	<b>61-35060-00</b> 0209.Y0 70 Ø 	<b>14-32075-01</b> 0204.83 (10x) 	

⑫ Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий



<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16 	<b>71-23542-30</b> 0304.46 	<b>81-21798-30 K</b> ← 0236.14 35x50x8 A SL WD ACM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x 	<b>71-38817-00</b> 2x 	<b>71-31147-00</b> 2x 0349.A6  <b>71-31862-00</b> △ 1709.10 	<b>71-33674-00</b> ⑮ 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x 	<b>71-38817-00</b> 2x 	<b>71-31147-00</b> 2x 0349.A6  <b>71-31862-00</b> △ 1709.10 	<b>71-33674-00</b> ⑮ 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x 	<b>71-38817-00</b> 2x 	<b>71-31147-00</b> 2x 0349.A6  <b>71-31862-00</b> △ 1709.10 	<b>71-33674-00</b> ⑮ 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x 	<b>71-35247-00</b> 4x 0342.E0 	<b>71-35068-00</b> 0349.J3  <b>71-36469-00</b> △ 1709.25 	<b>71-33674-00</b> ⑮ 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-34403-00 N</b> 0236.44 36x50x7 A SL RD FPM

⑮ Motorblockmaterial Grauguss / engine Block Material Grey Cast Iron / matériel pour bloc-moteur / material bloque motor Fonte grise / materiale blocco motore A getto di ghisa grigia / материал блока двигателя Серый чугун



CITROEN						
Ltr.						
1,1 109K 109/5 109/5E 109/5F	35-42 kW (48-57 PS) C15 LNA VISA 11	09/78-12/96	 <b>02-23307-01</b> ⑫ 0197.74  <b>08-23542-01</b> ⑬ ⑯ 0197.76	<b>61-23775-20</b> 0209.G8 76 Ø 1,2 mm Zentrierdurchm. 16 mm  <b>61-27265-10</b> 0209.A6 76 Ø 1,3 mm Zentrierdurchm. 14 mm 		
1,2 129/5	47 kW (64 PS) VISA Super X	07/80-06/82	 <b>02-23307-01</b> ⑫ 0197.74  <b>08-23542-01</b> ⑬ ⑯ 0197.76	<b>61-23775-20</b> 0209.G8 76 Ø 1,2 mm Zentrierdurchm. 16 mm  <b>61-27265-10</b> 0209.A6 76 Ø 1,3 mm Zentrierdurchm. 14 mm 		
1,3 G1A	47 kW (64 PS) C15	07/87-05/88		<b>61-23440-10</b> 78,5 Ø 1,2 mm 		
1,3 M4A	70 kW (95 PS) AX 13 Sport	04/87-12/88	 <b>02-31146-01</b> ⑫ 0197.H8  <b>02-31200-01</b> ⑫ ⑳ 0197.H8 +0209.CJ <b>08-33674-01</b> ⑬ ⑳	<b>61-33715-00</b> ⑵ 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 	

⑫ mit Zylinderlaufbuchsenringe / with cylinder liner rings / avec joints de chemises de cylindre / con anillos para camisa de cilindro / con anelli tenuta canna cilindro / с прокладками гильз цилиндров



<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16 	<b>71-23542-30</b> 0304.46 	<b>81-21798-30 K ←</b> 0236.14 35x50x8 A SL WD ACM <b>81-23578-00 K →</b> 0514.14 78x100x10 A LD MVQ
<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16 	<b>71-23542-30</b> 0304.46 	<b>81-21798-30 K ←</b> 0236.14 35x50x8 A SL WD ACM <b>81-23578-00 K →</b> 0514.14 78x100x10 A LD MVQ
<b>71-12902-00</b> 0249.53 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-24161-00</b> 0348.80 	<b>71-21665-10</b> 0349.E2 	<b>71-21718-00</b> 0304.32 	
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x		<b>71-31147-00</b> 2x 0249.A6  <b>71-31862-00</b> ⑳ 1709.10 	<b>71-33674-00</b> ⑵ 	<b>81-31863-00 K ←</b> 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K →</b> 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM

⑳ Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий



CITROEN						
Ltr.						
1,4 DV4D DV4TD 8HX (DV4TD)	40-55 kW (54-75 PS) C1 HDI C2 HDI C3 HDI C3 Pluriel HDI XSARA HDI XSARA HDI	02/02→		 <b>02-35542-01</b> (12)  <b>08-36869-01</b> (13)	<b>61-35430-00</b> 75 Ø 1,25 mm 2 MLS <b>61-35430-10</b> 0209.AE 75 Ø 1,3 mm 3 MLS <b>61-35430-20</b> 0209.AF 75 Ø 1,35 mm 1 MLS <b>61-35430-30</b> 0209.AG 75 Ø 1,4 mm 4 MLS <b>61-35430-40</b> 0209.AH 75 Ø 1,45 mm 5 MLS 	<b>14-32206-01</b> 0204.A2 (10x) 
1,4 KAY (TU3CP) KDZ (TU3M/Z) K1B K1F K1G K1H (TU3A) K2A K2B K3A	40-62 kW (55-85 PS) AX AX 14 BX 14 C15 ZX	09/86→		 <b>02-31146-01</b> (12) 0197.H8  <b>02-31200-01</b> (12 51) 0197.H8 +0209.CJ <b>08-33674-01</b> (13 51)	<b>61-33715-00</b> (51) 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 
1,4 KAZ KDX (TU3M/Z) KDY (TU3FM) KDY (TU3M) K2D	55 kW (75 PS) AX 14 BX 14 C15 VISA 14 GT ZX	03/82→		 <b>02-31146-01</b> (12) 0197.H8  <b>02-31146-02</b> (12 53) 0197.J0  <b>02-31200-01</b> (12 51) 0197.H8 +0209.CJ <b>02-33710-01</b> (12 53) 0197.J0 +0209.A9 <b>08-31859-01</b> (13 53)  <b>08-33674-01</b> (13 51)	<b>61-33710-00</b> (53) 0209.A9 76 Ø 1,2 mm  <b>61-33715-00</b> (51) 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10x) 

















⑫ Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий



<b>71-35542-00</b> 0249.C1 	<b>12-35548-01</b> 0956.50 (8x) <b>70-35548-00</b> 0956.50	<b>40-76246-00</b> 0348.T8	4x	<b>71-35487-00</b> 0349.J8 	<b>70-31414-10</b> 
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19	<b>71-38817-00</b> 2x 	8x	<b>71-31147-00</b> 0349.A6  <b>71-31862-00</b> 1709.10 	<b>71-33674-00</b> (51) 
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19	<b>71-38817-00</b> 2x 	8x	<b>71-31147-00</b> 0349.A6  <b>71-31862-00</b> 1709.10 	<b>71-33674-00</b> (51) 
				<b>81-35554-00 K ←</b> 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00 K →</b> 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00 N</b> 0807.30 27x47x7 A SL RD PTFE ACM	
				<b>81-31863-00 K ←</b> 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K →</b> 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM	
				<b>81-31863-00 K ←</b> 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K →</b> 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM	













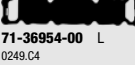






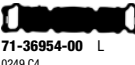


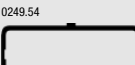





⑬ Motorblockmaterial Grauguß / engine Block Material Grey Cast Iron / matériel pour bloc-moteur / material bloque motor Fonte grise / materiale blocco motore A getto di ghisa grigia / материал блока двигателя Серый чугун



CITROEN						
Ltr. 						
1,4 KFU (ET3J4)	65 kW (88 PS) C3 16V C4 16V	12/03→	<b>02-36505-01</b> <sup>(12)</sup> <b>08-38533-01</b> <sup>(13)</sup>	<b>61-36505-00</b> 0209.FL 76 Ø 1,4 mm 	<b>14-32343-01</b> 0204.A5 (10X) 	
1,4 KFU (ET3J4)	65 kW (90 PS) C2	06/06→	<b>02-36505-01</b> <sup>(12)</sup> <b>08-38533-01</b> <sup>(13)</sup>	<b>61-36505-00</b> 0209.FL 76 Ø 1,4 mm 	<b>14-32343-01</b> 0204.A5 (10X) 	
1,4 KFU (TU3JP)	54 kW (73 PS) C2 C3 C3 Pluriel	02/02→	<b>02-31146-01</b> <sup>(12)</sup> 0197.H8  <b>02-31200-01</b> <sup>(12) (51)</sup> 0197.H8 +0209.CJ <b>08-33674-01</b> <sup>(13) (51)</sup>	<b>61-33715-00</b> <sup>(51)</sup> 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10X) 	
1,4 KFW (TU3JP) KFX (TU3JP) TU3JP	55 kW (75 PS) BERLINGO C2 SAXO VTS XSARA ZX	03/91→	<b>02-31146-01</b> <sup>(12)</sup> 0197.H8  <b>02-31200-01</b> <sup>(12) (51)</sup> 0197.H8 +0209.CJ <b>08-33674-01</b> <sup>(13) (51)</sup>	<b>61-33715-00</b> <sup>(51)</sup> 0209.CJ 76 Ø 1,3 mm 	<b>14-32075-01</b> 0204.83 (10X) 	

<sup>(51)</sup> Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий

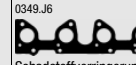

					
<b>71-36953-00</b> R 0249.C5  <b>71-36954-00</b> L 0249.C4 	<b>12-38538-01</b> 0956.52 (16x) <b>70-38538-00</b> 0956.52 16x	<b>11-36956-01</b> 0348.S1 	<b>71-35067-00</b> 0349.J4  <b>71-39639-00</b> 1709.29 	<b>70-31414-10</b> 	<b>81-38533-00</b> K ← 0514.A3 42x66x7 A SL RD <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-39633-00</b> N 0807.32 36x50x8 A SL RD PTFE ACM <b>81-39634-00</b> N 0807.33 24x50x8 A SL RD
<b>71-36953-00</b> R 0249.C5  <b>71-36954-00</b> L 0249.C4 	<b>12-38538-01</b> 0956.52 (16x) <b>70-38538-00</b> 0956.52 16x	<b>11-36956-01</b> 0348.S1 	<b>71-38542-00</b> 0349.L6  <b>71-39639-00</b> 1709.29 	<b>70-31414-10</b> 	<b>81-38533-00</b> K ← 0514.A3 42x66x7 A SL RD <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-39633-00</b> N 0807.32 36x50x8 A SL RD PTFE ACM <b>81-39634-00</b> N 0807.33 24x50x8 A SL RD
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x	<b>71-35247-00</b> 4x 0342.E0 	<b>71-31147-00</b> 2x 0349.A6 	<b>71-33674-00</b> <sup>(51)</sup> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x	<b>71-35247-00</b> 4x 0342.E0 	<b>71-31147-00</b> 2x 0349.A6  <b>71-33774-00</b> 0349.J6  Schadstoffverringierung FL5 <b>71-35068-00</b> 0349.J3  Abgasnorm L4	<b>71-33674-00</b> <sup>(51)</sup> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM



CITROEN						
Ltr.						
1,4 KFY (TU3FJ2) KFZ (TU3FJ2)	66-74 kW (90-100 PS)	AX 14 GTI	06/91-12/96	<b>02-28910-01</b> ⑫ 0197.10 +0209.D6	<b>61-28910-00</b> 0209.D6 77 Ø 1,2 mm <b>61-28910-10</b> 0209.C1 77 Ø 1,4 mm 	<b>14-32075-01</b> 0204.10(x) 
1,4 K9A (TUD3) K9Y (TUD3Y)	37-38 kW (50-52 PS)	AX 14 D ZX D	09/88-12/97	<b>02-31117-01</b> ⑫ 0197.K3  <b>08-31859-01</b> ⑬ ⑮ 	<b>61-31190-00</b> 0209.E9 76 Ø 1,8 mm <b>61-31190-10</b> 0209.N4 76 Ø 1,95 mm MLS 	<b>14-32076-01</b> 0204.84 (10x) 
1,4 150A 150C 150D 150D (XY7) 150F	44-53 kW (60-72 PS)	BX BX 14 C15 VISA 14	10/82→	<b>02-23307-02</b> ⑫ 0197.75  <b>02-27265-02</b> ⑫ 0197.75 +0209.A6 <b>08-23542-01</b> ⑬ ⑯ 0197.76	<b>61-23775-20</b> 0209.G8 76 Ø 1,2 mm Zentrierdurchm. 16 mm  <b>61-27265-10</b> 0209.A6 76 Ø 1,3 mm Zentrierdurchm. 14 mm 	
1,4 150B (XY8)	58 kW (79 PS)	VISA 14 GT	03/82-03/91	<b>02-23307-02</b> ⑫ 0197.75  <b>02-27265-02</b> ⑫ 0197.75 +0209.A6	<b>61-23775-20</b> 0209.G8 76 Ø 1,2 mm Zentrierdurchm. 16 mm  <b>61-27265-10</b> 0209.A6 76 Ø 1,3 mm Zentrierdurchm. 14 mm 	

⑫ mit Zylinderlaufbuchsenringe / with cylinder liner rings / avec joints de chemises de cylindre / con anillos para camisa de cilindro / con anelli tenuta canna cilindro / с вкладышами гильз цилиндров



<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x		<b>71-31147-00</b> 2x 0349.A6  <b>71-31118-00</b> 1710.58 	<b>70-31414-10</b> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
<b>71-31117-00</b> 0249.76 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x		<b>71-31119-00</b> 0349.E4 	<b>70-31414-10</b> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-00</b> N 0236.16 36x50x7 A NBR
<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16 	<b>71-23542-30</b> 0304.46 	<b>81-21798-30</b> K ← 0236.14 35x50x8 A SL WD ACM <b>81-23578-00</b> K → 0514.14 78x100x10 A LD MVQ
<b>71-23307-00</b> 0249.39 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-25149-10</b> 0348.54 	<b>71-23308-20</b> 0349.16  <b>71-26243-10</b> 1710.41 	<b>70-31414-10</b> 	<b>81-21798-30</b> K ← 0236.14 35x50x8 A SL WD ACM

⑮ Motorblockmaterial Grauguß / engine Block Material Grey Cast Iron / matériel pour bloc-moteur / material bloque motor Fonte grise / materiale blocco motore A getto di ghisa grigia / материал блока двигателя Серый чугун



CITROEN										
Ltr.										
1,4 8FS (EP3)	70 kW (95 PS) C3	02/09→	<b>02-38005-01</b> <sup>12</sup> <sup>19</sup>	<b>61-38005-00</b> 0209.EW 78 Ø 0,7 mm MLS 	<b>14-32347-01</b> 0204.C1 	<b>15-37633-01</b> 0249.F4 	<b>12-37621-01</b> 0956.60 <b>70-37621-00</b> 16x	<b>11-37632-01</b> 0348.T4 (4x) 	<b>70-31414-10</b> 	<b>81-41219-00</b> K ← 0514.C8 61x75x8 A SL RD <b>81-38532-00</b> K → 0514.A2 85x105x8 A SL LD
1,4 8HR (DV4C)	50 kW (68 PS)			<b>61-37945-00</b> 0209.HH 74,7 Ø 1,25 mm MLS 4	<b>14-32336-01</b> 0205.57 (10x) 	<b>71-40903-00</b> 0249.G2 	<b>12-35548-01</b> 0956.50 (8x) <b>70-35548-00</b> 8x	<b>71-39037-00</b> 0349.N9 	<b>70-31414-10</b> 	<b>81-35554-00</b> K ← 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00</b> K → 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00</b> N 0807.30 27x47x7 A SL RD PTFE ACM
1,4 8HY (DV4TED4)	66 kW (90 PS) C3 HDI 16V	02/02→	<b>02-36567-01</b> <sup>12</sup>  <b>08-36869-01</b> <sup>13</sup>	<b>61-37350-00</b> 0209.AJ 74,7 Ø 1,25 mm MLS <b>61-37350-10</b> 0209.AK 74,7 Ø 1,3 mm MLS <b>61-37350-20</b> 0209.AL 74,7 Ø 1,35 mm MLS <b>61-37350-30</b> 0209.AN 74,7 Ø 1,4 mm MLS <b>61-37350-40</b> 0209.AP 74,7 Ø 1,45 mm MLS 	<b>14-32206-01</b> 0204.A2 (10x) 	<b>71-36567-00</b> 0249.C2 	<b>12-36587-01</b> 0956.51 (16x) <b>70-36587-00</b> 16x	<b>40-76240-00</b> 4x 0348.R5  <b>40-76919-00</b> 4x 0348.R4 	<b>70-31414-10</b> 	<b>81-35554-00</b> K ← 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00</b> K → 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00</b> N 0807.30 27x47x7 A SL RD PTFE ACM

<sup>19</sup> mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров

















CITROEN														
1,5	VJY (TUD5) VJZ (TUD5)	40-43 kW (54-58 PS)	AX 15 D SAXO D XSARA D ZX D	08/94-09/03	<b>02-33645-01</b> ⑫ 0197.V1 +0209.T8 <b>08-33659-01</b> ⑬ 0197.V0 	<b>61-33645-00</b> 0209.T8 78,2 Ø 1,6 mm MLS 	<b>14-32163-01</b> 0204.85 (10x) 	<b>71-33661-00</b> 0249.81 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19	8x	<b>71-31119-00</b> 0349.E4 	<b>70-31414-10</b> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM	
1,6	BAY (XU5CP) BAZ (XU5CP) BDY (XU5M) BDZ (XU5M) B1A (XU51C/K) B1E (XU51C)	53-65 kW (72-88 PS)	BX 16 ZX	01/87-10/97	<b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-25415-08</b> 0197.H6 +0209.L3 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32079-01</b> 0204.57 (10x) 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70 <b>50-92244-00</b> ⚠ 1721.01 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
1,6	BFZ (XU5JP)	65 kW (88 PS)	XANTIA ZX	03/91-01/98	<b>02-25415-05</b> ⑫ 0197.G4 <b>08-25918-05</b> ⑬ 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32079-01</b> 0204.57 (10x) 	<b>71-33664-00</b> 0249.71 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-33663-00</b> 2x 0348.F6 	<b>71-35364-00</b> 1723.63 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
1,6	B6D XU52C 171A 171B 171C 171D 180Z	64-85 kW (87-116 PS)	BX BX 16 VISA 16 GTI	10/82-12/94	<b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-25415-08</b> 0197.H6 +0209.L3 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32078-01</b> 0204.89 (10x) ① →03/87 <b>14-32079-01</b> 0204.57 (10x) ① 04/87 → 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70 <b>50-92244-00</b> ⚠ 1721.01 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
1,6	B6E	85 kW (116 PS)	BX	01/87-01/92	<b>15-25415-04</b> ⑫ ⑬ 0197.H7 +0209.E1 <b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32079-01</b> 0204.57 (10x) 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-00</b> N 0236.16 36x50x7 A NBR



















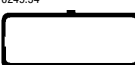




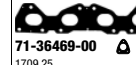


CITROEN												
1,6	DV6ATED4 DV6B DV6TED4 9HT (DV6BATED4) 9HT (DV6BUTED4) 9HX (DV6ATED4) 9HY (DV6TED4) 9HZ (DV6TED4)	55-80 kW (75-109 PS)	BERLINGO HDI BERLINGO HDI 75 BERLINGO HDI 90 C2 HDI C3 HDI C3 HDI 16V C4 C4 HDI C4 HDI 110 FAP C4 HDI 90 C5 HDI XSARA PICASSO HDI	05/04→  08-36869-01 <sup>13</sup>	<b>61-36265-00</b> 0209.CA 76 Ø 1,25 mm 2 MLS <b>61-36265-10</b> 0209.CC 76 Ø 1,3 mm 3 MLS <b>61-36265-20</b> 0209.CE 76 Ø 1,35 mm 1 MLS <b>61-36265-30</b> 0209.CF 76 Ø 1,4 mm 4 MLS <b>61-36265-40</b> 0209.CG 76 Ø 1,45 mm 5 MLS 	<b>14-32206-01</b> 0204.A2 (10x) 	<b>71-36567-00</b> 0249.C2 	<b>12-36587-01</b> 0956.51 (16x) <b>70-36587-00</b> 0956.51 16x	<b>40-76240-00</b> 0348.R5 4x  <b>40-76919-00</b> 0348.R4 4x 	<b>71-35487-00</b> 0349.J8 	<b>70-31414-10</b> 	<b>81-35554-00</b> K ← 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00</b> K → 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00</b> N 0807.30 27x47x7 A SL RD PTFE ACM
1,6	DV6C <b>[NEW]</b>	82 kW (110 PS)			<b>61-37940-00</b> 0209.JF 75,7 Ø 1,25 mm 5 MLS <b>61-37940-10</b> 0209.JG 75,7 Ø 1,3 mm 6 MLS <b>61-37940-20</b> 0209.JH 75,7 Ø 1,35 mm 4 MLS <b>61-37940-30</b> 0209.JJ 75,7 Ø 1,4 mm 7 MLS <b>61-37940-40</b> 0209.JK 75,7 Ø 1,45 mm 8 MLS 	<b>14-32336-01</b> 0205.57 (10x) 	<b>71-40903-00</b> 0249.G2 	<b>12-35548-01</b> 0956.50 (8x) <b>70-35548-00</b> 0956.50 8x	<b>71-38503-00</b> 0349.N5  <b>71-39037-00</b> 0349.N9 	<b>70-31414-10</b> 	<b>81-35554-00</b> K ← 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00</b> K → 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00</b> N 0807.30 27x47x7 A SL RD PTFE ACM	
1,6	EP6DT 5FR (EP6DT) 5FU (EP6DT) 5FU (EP6DTS) 5FV (EP6DT) 5FX (EP6DT) <b>[NEW]</b>	103-135 kW (140-184 PS)	C4 C5 DS3	07/08→  02-38010-01 <sup>12</sup> <sup>13</sup> 02-38010-02 <sup>12</sup>	<b>61-38010-00</b> 0209.ER 78 Ø 1 mm MLS 	<b>14-32347-01</b> 0204.C1 	<b>15-37614-01</b> 0249.E6 +0249.E7 	<b>12-37621-01</b> 0956.60 <b>70-37621-00</b> 16x	<b>11-37616-01</b> 0348.S9 	<b>70-31414-10</b> 	<b>81-41219-00</b> K ← 0514.C8 61x75x8 A SL RD <b>81-38532-00</b> K → 0514.A2 85x105x8 A SL LD	

<sup>13</sup> mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



CITROEN						
Ltr. 						
1,6 NFR (TU5JP4B) NFU (TU5JP4)	66-81 kW (90-110 PS)	BERLINGO BERLINGO 16V C2 C3 Pluriel C3 16V C4 C4 16V XSARA PICASSO 16V XSARA 16V	09/00→	<b>02-35055-01</b> ⑫ <b>08-35253-01</b> ⑬	<b>61-35055-00</b> 0209.1E 78,5 ∅ MLS 	<b>14-32139-01</b> 0204.81 (10x) 
1,6 NFS (TU5JP4S)	90 kW (122 PS)	C2 VTS	01/05→	<b>02-35055-02</b> ⑫ <b>08-38532-01</b> ⑬	<b>61-35055-00</b> 0209.1E 78,5 ∅ MLS 	<b>14-32139-01</b> 0204.81 (10x) 
1,6 NFT NFV (TU5JP) NFZ (TU5JP)	65-74 kW (88-101 PS)	SAXO SAXO VTL,VTR SAXO VTS XSARA XSARA PICASSO	05/96→	<b>02-28980-01</b> ⑫ 0197.J0 +0209.F6 → 07874 <b>02-31595-01</b> ⑫ 0197.J0 +0209.W8 → 07875→ <b>02-31146-02</b> ⑫ ⑬ 0197.J0  <b>08-33674-01</b> ⑬ ⑮	<b>61-28980-00</b> 0209.F6 79 ∅ 1,5 mm → 07874 <b>61-28980-10</b> 0209.F7 79 ∅ 1,7 mm → 07874  <b>61-31595-00</b> 0209.W8 79,7 ∅ 1,37 mm MLS → 07875→ <b>61-31595-10</b> 0209.W9 79,7 ∅ 1,57 mm MLS → 07875→ 	<b>14-32075-01</b> 0204.83 (10x) 

⑮ Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий

					
<b>71-35251-00</b> 2x 0249.A9 	<b>12-33512-02</b> 0956.40 (16x) <b>70-33512-00</b> 0956.40 16x	<b>11-35246-01</b> 0348.05 	<b>71-35067-00</b> 0349.J4  <b>71-36469-00</b> 1709.25 	<b>71-35253-00</b> 0304.55 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-34146-00 N</b> 2x 0807.24 38x50x6 A SL RD FPM
<b>71-35251-00</b> 2x 0249.A9 	<b>12-33512-02</b> 0956.40 (16x) <b>70-33512-00</b> 0956.40 16x	<b>71-38543-00</b> 0342.J6  <b>71-38544-00</b>   0342.J5 	<b>71-38542-00</b> 0349.L6 	<b>70-31414-10</b> 	<b>81-38533-00 K</b> ← 0514.A3 42x66x7 A SL RD <b>81-38532-00 K</b> → 0514.A2 85x105x8 A SL LD <b>81-38531-00 N</b> 2x 0807.34 38x50x7 A SL RD
<b>71-31146-00</b> 0249.54 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x	<b>11-38519-01</b> 1635.08  <b>71-35249-00</b> 0348.E5 → 07874  <b>71-35248-00</b> 0348.P3 → 07875→ 	<b>71-31147-00</b> 2x 0349.A6  <b>71-35068-00</b> 0349.J3  <b>71-36469-00</b> 1709.25 	<b>71-33674-00</b> ⑮ 	<b>81-31863-00 K</b> ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50 K</b> → 0514.74 85x105x8 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM

⑮ Motorblockmaterial Grauguss / engine Block Material Grey Cast Iron / matériel pour bloc-moteur / material bloque motor Fonte grise / materiale blocco motore A getto di ghisa grigia / материал блока двигателя Серый чугун

I innen / inside / intérieur / interior / interno / внутри



CITROEN						
Ltr.						
1,6 NFX (TU5J4)	87-88 kW (118-120 PS) SAXO SAXO VTS	02/96-04/04	<b>02-31850-01</b> ⑫ <b>08-33674-01</b> ⑬ ⑮	<b>61-31850-00</b> 0209.Z0 79,7 ∅ 1,37 mm 6 MLS <b>61-31850-10</b> 0209.W3 79,7 ∅ 1,57 mm 7 MLS <b>61-31850-20</b> 0209.Z1 79,7 ∅ 1,77 mm 8 MLS 	<b>14-32139-01</b> 0204.81 (10x) 	
1,6 1580 SPI 220 A2.000	58 kW (79 PS) JUMPY	10/95→	<b>01-31755-03</b> ⑫ ⑬ <b>02-31755-06</b> ⑫ 0197.V3	<b>61-31755-00</b> 0209.P9 87,3 ∅ 		
1,6 180A (XU5J)	76 kW (103 PS) VISA 16 GTI	01/85-06/86	<b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-25415-08</b> 0197.H6 +0209.L3 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 ∅ 1,3 mm <b>61-25415-40</b> 0209.L3 84 ∅ 1,5 mm 	<b>14-32078-01</b> 0204.89 (10x) 	
1,6 5FS (EP6C) 5FW (EP6) <b>[NEW]</b>	88 kW (120 PS) BERLINGO C3 C4 C5 DS3 DS4	07/08→	<b>02-38005-01</b> ⑫ ⑬	<b>61-38005-00</b> 0209.EW 78 ∅ 0,7 mm MLS 	<b>14-32347-01</b> 0204.C1 	
1,6 5FV (EP6CDT) <b>[NEW]</b>	115 kW (156 PS) DS4 DS5	04/11→	<b>02-38010-01</b> ⑫ ⑬	<b>61-38010-00</b> 0209.ER 78 ∅ 1 mm MLS 	<b>14-32347-01</b> 0204.C1 	

⑦ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

⑧ mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>70-31414-10</b> 	<b>12-33512-02</b> 0956.40 (16x) <b>70-33512-00</b> 0956.40	16x	<b>71-34449-00</b> 0348.L0	4x	<b>71-34451-00</b> 0349.F9 	<b>70-31414-10</b> 	<b>81-31863-00</b> K ← 0514.72 42x66x6 A SL RD FPM <b>81-23708-50</b> K → 0514.74 85x105x8 A SL LD FPM <b>81-34146-00</b> N 2x 0807.24 38x50x6 A SL RD FPM
<b>71-31732-00</b> 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-35716-00</b> ⑦	2x		<b>71-31742-00</b> 0304.49 	<b>81-35883-00</b> N 30x52x7 AB SL RD FPM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22	8x	<b>71-31379-10</b> 0349.91 	4x	<b>71-26236-10</b> 0349.70 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM
<b>15-37633-01</b> 0249.F4 	<b>12-37621-01</b> 0956.60 <b>70-37621-00</b>	16x	<b>11-37632-01</b> 0348.T4 (4x) 			<b>70-31414-10</b> 	<b>81-41219-00</b> K ← 0514.C8 61x75x8 A SL RD <b>81-38532-00</b> K → 0514.A2 85x105x8 A SL LD
<b>15-37614-01</b> 0249.E6 +0249.E7 	<b>12-37621-01</b> 0956.60 <b>70-37621-00</b>	16x	<b>11-37616-01</b> 0348.S9 			<b>70-31414-10</b> 	<b>81-41219-00</b> K ← 0514.C8 61x75x8 A SL RD <b>81-38532-00</b> K → 0514.A2 85x105x8 A SL LD

⑤ Motorblockmaterial Aluminium / engine Block Material Aluminium / matériel pour bloc-moteur aluminium / material bloque motor Aluminio / materiale blocco motore Alluminio / материал блока двигателя алюминий



CITROEN						
Ltr.						
1,6 9HY (DV6TED4)	80 kW (109 PS) C4 HDI C4 HDI 110 FAP	11/04→				
			<b>02-36567-01</b> <sup>12</sup> 	<b>61-36265-00</b> 0209.CA 76 Ø 1,25 mm 2 MLS <b>61-36265-10</b> 0209.CC 76 Ø 1,3 mm 3 MLS <b>61-36265-20</b> 0209.CE 76 Ø 1,35 mm 1 MLS <b>61-36265-30</b> 0209.CF 76 Ø 1,4 mm 4 MLS <b>61-36265-40</b> 0209.CG 76 Ø 1,45 mm 5 	<b>14-32206-01</b> 0204.A2 (10x) 	
1,8 AJZ (XUD7TE) A8A (XUD7TE)	66 kW (90 PS) BX TRD BX 18 TRD	03/88-12/94	<b>02-25942-05</b> <sup>12</sup>  <b>02-25942-06</b> <sup>12</sup>  <b>08-25918-02</b> <sup>13</sup> 	<b>61-33670-00</b> 0209.00 82 Ø 1,54 mm 2 <b>61-33670-10</b> 0209.01 82 Ø 1,64 mm 3 	<b>14-32077-01</b> 0204.65 (10x) 	

<b>71-36567-00</b> 0249.C2 	<b>12-36587-01</b> 0956.51 (16x) <b>70-36587-00</b> 0956.51 16x	<b>40-76240-00</b> 0348.R5 4x  <b>40-76919-00</b> 0348.R4 4x 	<b>71-35487-00</b> 0349.J8 	<b>70-31414-10</b> 	<b>81-35554-00</b> K ← 0127.42 40x55x6,4 A SL RD PTFE ACM <b>81-35553-00</b> K → 0127.43 85x105x8,8 A SL LD PTFE ACM <b>81-35552-00</b> N 0807.30 27x47x7 A SL RD PTFE ACM
<b>71-25942-00</b> 0249.91 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>50-92244-00</b> 1721.01  <b>71-33682-00</b> <sup>7</sup> 0348.89  <b>71-33683-00</b> <sup>7</sup> 0348.J0 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM	

⑫ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



CITROEN														
1,8 A9A (XUD7) 161 (XUD7) 161A (XUD7)	43-44 kW (58-60 PS)	BERLINGO D BX 18 D C15 D VISA 17 D XSARA D ZX D	04/84→	<b>02-25942-03</b> 0197.H4  <b>02-25942-04</b> ⑫ 0197.H4 +0956.22 (8x)  <b>08-25918-02</b> ⑬	<b>61-29145-10</b> 0209.F9 82 Ø 1,6 mm 2 M <b>61-29145-20</b> 0209.G0 82 Ø 1,7 mm 3 M  <b>61-31060-00</b> 0209.S0 82 Ø 1,4 mm 1 M <b>61-31060-10</b> 0209.S1 82 Ø 1,45 mm 2 M <b>61-31060-20</b> 0209.S2 82 Ø 1,5 mm 3 M <b>61-31060-30</b> 0209.S3 82 Ø 1,55 mm 4 M <b>61-31060-40</b> 0209.S4 82 Ø 1,6 mm 5 M 	<b>14-32077-01</b> 0204.65 (10x) 		<b>71-25942-00</b> 0249.91 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-33156-00</b> 0348.98  <b>71-33157-00</b> 0348.99 2x 	<b>71-25919-30</b> 2x 0349.78 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30 N</b> 0236.14 35x50x8 A SL WD ACM	
1,8 LFX (XU7JB)	66 kW (90 PS)	BERLINGO XANTIA XSARA	04/97→	<b>02-25415-09</b> ⑫ <b>08-25918-05</b> ⑬	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 			<b>71-33664-00</b> 0249.71 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-34418-00</b> 4x 0348.L7 	<b>71-35364-00</b> 1723.63 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM	
1,8 LFY (XU7JP4)	81-85 kW (110-115 PS)	XANTIA 16V XSARA PICASSO 16V XSARA 16V ZX ZX 16V	06/95→	<b>01-35040-01</b> ⑫ ⑬ 0197.V5 +0209.03 +0249.A2 +0249.A3 → 07965 <b>01-35040-02</b> ⑫ ⑬ 0197.X7 +0209.03 +0249.A2 +0249.A3 → 07966→ <b>02-35040-01</b> ⑫ → 07965 <b>02-35040-02</b> ⑫ → 07966→	<b>61-35040-00</b> 0209.03 84 Ø 	<b>14-32155-01</b> 0204.80 (10x) 		<b>71-34446-00 R</b> 0249.A3  <b>71-34447-00 L</b> 0249.A2 	<b>12-35257-01</b> 0956.34 (16x) → 07363 <b>12-34438-01</b> 0956.42 (16x) → 07364→ → 07965 <b>12-34439-01</b> 0956.45 (16x) → 07966→ <b>70-35257-00</b> 0956.34 → 07363 <b>70-34438-00</b> 0956.42 → 07364→ → 07965 <b>70-34439-00</b> 0956.45 → 07966→	<b>71-34448-00</b> 4x 0348.L7 	<b>71-35899-00</b> 4x 0348.K6 → 07038→ 	<b>71-34443-00</b> 0349.F4 → 07664  <b>71-35768-00</b> 0349.H0 → 07665→ 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00 N</b> 2x 0236.44 36x50x7 A SL RD FPM





CITROEN						
Ltr.						
1,9 DFW (XU9J4) D6C (XU9J4)	108-116 kW (147-158 PS)	BX 19 GTI 16V	09/87-02/93	<b>02-25415-07</b> ⑫ 0197.J2 +0209.L3 <b>02-33668-01</b> ⑫ 0197.J2  <b>08-25918-05</b> ⑬	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32079-01</b> 0204.57 (10x) 
1,9 DFZ (XU9J1)	75 kW (102 PS)	BX 19	07/86-12/94	<b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-26237-01</b> ⑫ 0197.H6  <b>08-25918-05</b> ⑬	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm 	<b>14-32078-01</b> 0204.89 (10x) ① →03/87 <b>14-32079-01</b> 0204.57 (10x) ① 04/87→ 
1,9 DHV (XUD9BSD) DHW (XUD9SD) DHY (XUD9TE/BTF) DHY (XUD9TE/Y) D8B (XUD9TF) D8C (XUD9UTF)	55-68 kW (75-92 PS)	EVASION EVASION TD JUMPER Bus TD JUMPER TD JUMPY TD XANTIA SD XANTIA TD XSARA D XSARA SD XSARA TD ZX TD	07/92→	<b>02-25942-06</b> ⑫  <b>08-25918-02</b> ⑬	<b>61-33155-00</b> 0209.08 84 Ø 1,36 mm MLS <b>61-33155-10</b> 0209.09 84 Ø 1,4 mm MLS <b>61-33155-20</b> 0209.R0 84 Ø 1,44 mm MLS <b>61-33155-30</b> 0209.R1 84 Ø 1,48 mm MLS <b>61-33155-40</b> 0209.R2 84 Ø 1,53 mm MLS <b>61-33155-50</b> 84 Ø 1,59 mm MLS <b>61-33155-60</b> 1,7 mm MLS 	<b>14-32177-01</b> 0204.73 (10x) 

<b>71-33668-00</b> 0249.74 	<b>12-26058-03</b> 0956.19 (16x) <b>70-26058-00</b> 0956.19 16x	<b>71-33684-00</b> 2x 0348.G4 	<b>71-33686-00</b> 0349.E8 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-22660-00 N</b> 2x 0236.24 32x45x7 A LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70 <b>50-92244-00</b> ⑩ 1721.01 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM
<b>71-25942-00</b> 0249.91 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>50-92244-00</b> ⑩ 1721.01 	<b>71-33683-00</b> ⑦ 0348.J0 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30 N</b> 0236.14 35x50x8 A SL WD ACM

⑩ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



CITROEN						
Ltr.						
1,9 DJY (XUD9A) DJZ (XUD9Y) D9B (XUD9A/L) D9B (XUD9A/U)	47-51 kW (64-70 PS) BERLINGO D BX 19 D C25 C25 Bus D C25 D JUMPER Bus D JUMPER D JUMPY D XANTIA D XSARA D ZX D	09/83→	 <b>02-25942-05</b> ⑫  <b>08-25918-02</b> ⑬	 <b>61-29165-10</b> 0209.K0 84 Ø 1,6 mm 2  <b>61-29165-20</b> 0209.K1 84 Ø 1,7 mm 3  <b>61-31065-00</b> 0209.S5 84 Ø 1,4 mm 1  <b>61-31065-10</b> 0209.S6 84 Ø 1,45 mm 2  <b>61-31065-20</b> 0209.S7 84 Ø 1,5 mm 3  <b>61-31065-30</b> 0209.S8 84 Ø 1,55 mm 4  <b>61-31065-40</b> 0209.S9 84 Ø 1,6 mm 5	 <b>14-32077-01</b> 0204.65 (10x)	
1,9 DKZ (XU9JA) D2C (XU92C) D2F	70-88 kW (95-120 PS) BX 19 BX 19 GTI ZX	12/87-06/97	 <b>15-25415-04</b> ⑫ ⑬ 0197.H7 +0209.E1  <b>02-25415-03</b> ⑫ 0197.H6 +0209.E1  <b>02-26237-01</b> ⑫ 0197.H6  <b>08-25918-05</b> ⑬	 <b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm  <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm	 <b>14-32079-01</b> 0204.57 (10x)	

⑫ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена

<b>71-25942-00</b> 0249.91 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>50-92244-00</b> 1721.01  <b>71-33682-00</b> ⑦ 0348.89 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30</b> N 0236.14 35x50x8 A SL WD ACM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70  <b>50-92244-00</b> 1721.01 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 0236.44 36x50x7 A SL RD FPM

⑦ für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehículos sin aire acondicionado / per veicoli senza aria condizionata / оснащение / оборудование для автомобилей без кондиционера



CITROEN												
Ltr.												
1,9 DW8B WJY (DW8B) WJZ (DW8)	51 kW (69-70 PS) BERLINGO D JUMPY D XSARA D	04/98→		<b>01-34356-01</b> ⑫ ⑬ 0197.X6 +0127.28 +0326.22 +0807.14 	<b>61-33720-00</b> 0209.X0 84 Ø 1,26 mm 3 MLS <b>61-33720-10</b> 0209.X1 84 Ø 1,3 mm 4 MLS <b>61-33720-20</b> 0209.X2 84 Ø 1,34 mm 5 MLS <b>61-33720-30</b> 0209.X3 84 Ø 1,38 mm 6 MLS <b>61-33720-40</b> 0209.X4 84 Ø 1,42 mm 7 MLS <b>61-33720-50</b> 0209.1C 84 Ø 1,47 mm 4 MLS 	<b>14-32077-01</b> 0204.65 (10x) → 08469  <b>14-32116-01</b> 0204.97 (10x) → 08470→ 	<b>15-34356-01</b> 0249.95 +0249.97 <b>71-34353-00</b> U 0249.97  <b>71-34356-00</b> O 0249.95 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-34997-00</b> 0348.N1  <b>71-34998-00</b> 2x 0348.N2 	<b>71-29465-00</b> 2x 0349.H7 	<b>71-25918-30</b> ⑳ 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-25451-10</b> N 0514.15 35x50x7 A SL RD FPM
1,9 D2A (XU92C) D2C (XU92C) D6A (XU9J2) 159A	70-90 kW (95-122 PS) BX 19 BX 19 GTI	07/86-12/94		<b>15-25415-04</b> ⑫ ⑬ 0197.H7 +0209.E1 <b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32078-01</b> 0204.89 (10x) → 03/87  <b>14-32079-01</b> 0204.57 (10x) → 04/87→ 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70  <b>50-92244-00</b> ① 1721.01 	<b>71-25918-30</b> ⑳ 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 0236.44 36x50x7 A SL RD FPM
1,9 D6E (XU9JA)	93 kW (126 PS) ZX	03/91-06/97		<b>02-25415-03</b> ⑫ 0197.H6 +0209.E1 <b>02-25415-08</b> 0197.H6 +0209.L3 <b>02-26237-01</b> ⑫ 0197.H6 	<b>61-25415-30</b> 0209.E1 84 Ø 1,3 mm <b>61-25415-40</b> 0209.L3 84 Ø 1,5 mm 	<b>14-32079-01</b> 0204.57 (10x) 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 4x 0349.70  <b>71-27178-10</b> ① 1710.39 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM

⑳ für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehiculos sin aire acondicionado / per veicoli senza aria condizionata /  
оснащение / оборудование для автомобилей без кондиционера

O oben / top / haut / arriba / superiore / сверху  
U unten / bottom / bas / debajo / inferiore / снизу



CITROEN						
Ltr.						
1,9 D9A (XUD9) 162 (XUD9)	47 kW (64 PS) BX 19 D	09/83-12/87		<p><b>02-25942-03</b> 0197.H4 1 → 03/87 </p> <p><b>02-25942-04</b> ⑫ 0197.H4 +0956.22 (8x) 1 → 03/87 </p> <p><b>02-25942-05</b> ⑫ 1 → 04/87 → </p> <p><b>08-25918-02</b> ⑬ </p>	<p><b>61-29165-10</b> 0209.K0 84 Ø 1,6 mm 2 </p> <p><b>61-29165-20</b> 0209.K1 84 Ø 1,7 mm 3 </p> <p><b>61-31065-00</b> 0209.S5 84 Ø 1,4 mm 1 </p> <p><b>61-31065-10</b> 0209.S6 84 Ø 1,45 mm 2 </p> <p><b>61-31065-20</b> 0209.S7 84 Ø 1,5 mm 3 </p> <p><b>61-31065-30</b> 0209.S8 84 Ø 1,55 mm 4 </p> <p><b>61-31065-40</b> 0209.S9 84 Ø 1,6 mm 5 </p>	<p><b>14-32077-01</b> 0204.65 (10x) </p>
2,0 DW10ATED (RHZ) DW10BTED (RHX) DW10TD/ATED(RHZ/RHY) RHS (DW10ATED) RHX RHX (DW10BTED) RHY (DW10TD) RHZ (DW10ATED)	66-80 kW (90-109 PS)	05/97 →	<p><b>01-34398-01</b> ⑫ ⑬ 0197.X4 </p> <p><b>02-34398-01</b> ⑫ 0197.X3 </p>	<p><b>61-35815-00</b> 0209.X5 86 Ø 1,3 mm 1 </p> <p><b>61-35815-10</b> 0209.X6 86 Ø 1,35 mm 2 </p> <p><b>61-35815-20</b> 0209.X7 86 Ø 1,4 mm 3 </p> <p><b>61-35815-30</b> 0209.X8 86 Ø 1,45 mm 4 </p> <p><b>61-35815-40</b> 0209.X9 86 Ø 1,5 mm 5 </p>	<p><b>14-35774-01</b> 0204.A6 (10x) </p>	

<p><b>71-25942-00</b> 0249.91 </p>	<p><b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22</p>	<p><b>71-33156-00</b> 0348.98 1 → 03/87 </p> <p><b>71-33157-00</b> 0348.99 1 → 03/87 </p> <p><b>71-33682-00</b> ⑦ 0348.89 1 → 04/87 → </p>	<p><b>71-25919-30</b> 2x 0349.78 1 → 03/87 </p> <p><b>50-92244-00</b> </p> <p>1721.01 </p>	<p><b>71-25918-30</b> 0304.34 </p>	<p><b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30</b> N 0236.14 35x50x8 A SL WD ACM</p>
<p><b>71-34398-00</b> 0249.99 </p>	<p><b>12-31306-07</b> 0956.38 (8x) → 08331 <b>12-34399-01</b> 0956.48 (8x) → 08332 → <b>70-31306-00</b> 0956.38 → 08331 <b>70-34399-00</b> 0956.48 → 08332 →</p>	<p><b>71-34401-00</b> 0348.N4 </p>	<p><b>71-34402-00</b> 0349.H4 </p>	<p><b>70-31414-10</b> </p>	<p><b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34144-00</b> N 0807.28 27x47x7 A SL RD FPM</p>

⑦ Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



CITROEN						
Ltr.						
2,0 DW10BTD4 RHJ (DW10BTD4) RHR (DW10BTD4)	100 kW (136 PS) C4 HDI C4 HDI 135 FAP C4 HDI 135 FFAP C5 HDI C8 HDI JUMPY HDI 140	09/04→	 <b>01-36571-01</b> <sup>12</sup> <sup>13</sup> 0197.AE +0348.S3  <b>02-36571-01</b> <sup>12</sup> 0197.AC +0348.S3 	<b>61-34370-00</b> 0209.AV 86 Ø 1,25 mm 2 MLS <b>61-34370-10</b> 0209.AW 86 Ø 1,3 mm 3 MLS <b>61-34370-20</b> 0209.AX 86 Ø 1,35 mm 4 MLS <b>61-34370-30</b> 0209.AY 86 Ø 1,4 mm 5 MLS 	<b>14-35774-01</b> 0204.A6 (10x) 	
2,0 DW10TD DW10UTD	62-66 kW (84-90 PS) BERLINGO HDI C25 HDI JUMPER Bus HDI JUMPER HDI	11/01→	 <b>01-34398-01</b> <sup>12</sup> <sup>13</sup> 0197.X4  <b>02-34398-01</b> <sup>12</sup> 0197.X3 	<b>61-35815-00</b> 0209.X5 86 Ø 1,3 mm 1 MLS <b>61-35815-10</b> 0209.X6 86 Ø 1,35 mm 2 MLS <b>61-35815-20</b> 0209.X7 86 Ø 1,4 mm 3 MLS <b>61-35815-30</b> 0209.X8 86 Ø 1,45 mm 4 MLS <b>61-35815-40</b> 0209.X9 86 Ø 1,5 mm 5 MLS 	<b>14-35774-01</b> 0204.A6 (10x) 	
2,0 EW10A RFJ (EW10A)	103 kW (140 PS) C4 C4 16V C5 C5 16V C8 16V	09/04→	<b>01-37360-01</b> <sup>12</sup> <sup>13</sup> <sup>19</sup> <b>02-37360-01</b> <sup>12</sup> <sup>19</sup>	<b>61-37360-00</b> 0209.FS MLS 	<b>14-32342-01</b> 0204.A3 (10x) 	

<sup>19</sup> mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>15-36571-01</b> 0348.S3 	<b>12-36588-01</b> 0956.48 (16x) <b>70-36588-00</b> 0956.48 16x		<b>71-33223-00</b> 0349.J2 	<b>70-31414-10</b> 	<b>81-36557-00 K ←</b> 0127.47 42x62x7 A SL RD PTFE <b>81-36556-00 K →</b> 0127.45 90x110x7 A SL LD PTFE <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM
<b>71-34398-00</b> 0249.99 	<b>12-34399-01</b> 0956.48 (8x) <b>70-34399-00</b> 0956.48 8x	<b>71-34401-00</b> 0348.N4 	<b>71-34402-00</b> 0349.H4 	<b>70-31414-10</b> 	<b>81-25926-10 K ←</b> 0326.12 42x62x8 A RD FPM <b>81-34456-00 K →</b> 0127.28 90x110x7 A SL LD FPM <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM
	<b>12-34439-01</b> 0956.45 (16x) <b>70-34439-00</b> 0956.45 16x	<b>71-38549-00</b> 0348.S2 	<b>71-34992-00</b> 0349.L4 	<b>70-31414-10</b> 	<b>81-34454-00 K ←</b> 0326.27 40x55x6,5 A SL RD FPM <b>81-34456-00 K →</b> 0127.28 90x110x7 A SL LD FPM <b>81-34403-00 N</b> 0236.44 36x50x7 A SL RD FPM <b>81-38657-00 N</b> 0236.74 39x50x7 A SL RD



CITROEN						
Ltr.						
2,0 EW10J4 (RFN) RFN (EW10J4)	100-103 kW (136-140 PS) C4 16V C5 16V C8 EVASION 16V JUMPY JUMPY 16V XSARA PICASSO 16V XSARA 16V	03/00→	<b>01-35045-01</b> 0197.Y1 +0209.Z3 +0249.A4 +0249.A5 <b>02-35045-01</b> <b>08-37006-01</b> 	<b>61-35045-00</b> 0209.Z3 85 Ø MLS 	<b>14-32234-01</b> 0204.A7 (10x) 	
2,0 EW10J4S RFK (EW10J4S)	130 kW (177 PS) C4 C4 16V	11/04→	<b>01-35045-04</b> <b>02-35045-04</b> <b>08-37006-04</b>	<b>61-35045-00</b> 0209.Z3 85 Ø MLS 	<b>14-32342-01</b> 0204.A3 (10x) 	
2,0 RDZ (XU10MZ) RFZ (XU10J2) XU102C	79-89 kW (107-121 PS) XM	05/89-06/94	<b>02-33665-01</b> 0197.C8 +0209.N1 <b>08-25918-04</b>	<b>61-33665-00</b> 0209.N1 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	
2,0 RFS (XU10J4RS)	120 kW (163 PS) XSARA 16V ZX 16V	05/96-03/05	<b>01-35050-01</b> 0197.W2 +0209.Z2 <b>02-35050-01</b> <b>08-25918-04</b>	<b>61-35050-00</b> 0209.Z2 86,5 Ø MLS 	<b>14-32148-01</b> 0204.72 (10x) 	
2,0 RFT (XU10J4/Z)	110-112 kW (150-152 PS) XANTIA 16V ZX 16V	07/92-01/98	<b>02-33660-01</b> 0197.G7 +0209.N0 <b>08-25918-04</b>	<b>61-33660-00</b> 0209.N0 87,3 Ø 1,35 mm 	<b>14-32148-01</b> 0204.72 (10x) 	

mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров



<b>71-34452-00</b> R 0249.A5 	<b>12-34439-01</b> 0956.45 (16x) <b>70-34439-00</b> 0956.45 16x 	<b>71-35903-00</b> 4x 0348.P1 	<b>71-33853-00</b> 0349.H8 	<b>70-31414-10</b> 	<b>81-34454-00</b> K ← 0326.27 40x55x6,5 A SL RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 2x 0236.44 36x50x7 A SL RD FPM
<b>71-34452-00</b> R 0249.A5 	<b>12-34439-01</b> 0956.45 (16x) <b>70-34439-00</b> 0956.45 16x 	<b>71-36957-00</b> 0348.R8 	<b>71-33853-00</b> 0349.H8 	<b>70-31414-10</b> 	<b>81-34454-00</b> K ← 0326.27 40x55x6,5 A SL RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 2x 0236.44 36x50x7 A SL RD FPM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-33676-00</b> 0348.E0 	<b>71-26236-10</b> 4x 0349.70 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10</b> N 0236.21 36x50x8 A RD ACM
<b>70-31414-10</b> 	<b>12-31306-01</b> <b>70-31306-00</b> 0956.38 16x 	<b>71-33666-00</b> 0348.C8 	<b>71-34443-00</b> 0349.F4 	<b>70-31414-10</b> 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 2x 0236.44 36x50x7 A SL RD FPM
<b>71-33668-00</b> 0249.74 	<b>12-26058-03</b> 0956.19 (16x) <b>70-26058-00</b> 0956.19 16x 	<b>71-33666-00</b> 0348.C8 	<b>71-33667-00</b> 0349.98 	<b>70-31414-10</b> 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10</b> N 2x 0236.21 36x50x8 A RD ACM



CITROEN											
Ltr.											
2,0 RFV (XU10J2/C)	89 kW (121 PS) EVASION	06/94-07/02	<b>02-33650-03</b> ⑫ 0197.T8 +0209.J8 <b>08-25918-04</b> ⑬	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-34361-00</b> 2x 0348.N0 	<b>71-26236-10</b> 4x 0349.70 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
2,0 RFV (XU10J4R)	97 kW (132 PS) EVASION 16V XANTIA 16V XM 16V XSARA 16V	05/94-04/03	<b>01-33650-05</b> ⑫ ⑬ 0197.V2 +0209.N6 +0249.A2 +0249.A3 <b>01-33650-06</b> ⑫ ⑬ 0197.X8 +0209.N6 +0249.A2 +0249.A3 ➔ 07965 <b>02-33650-05</b> ⑫ ➔ 07965 <b>02-33650-06</b> ⑫ ➔ 07966→	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32148-01</b> 0204.72 (10x) 	<b>71-34446-00 R</b> 0249.A3  <b>71-34447-00 L</b> 0249.A2 	<b>12-35257-01</b> 0956.34 (16x) ➔ 07359 <b>12-34438-01</b> 0956.42 (16x) ➔ 07360→ ➔ 07965 <b>12-34439-01</b> 0956.45 (16x) ➔ 07966→ <b>70-35257-00</b> 0956.34 ➔ 07359 <b>70-34438-00</b> 0956.42 ➔ 07360→ ➔ 07965 <b>70-34439-00</b> 0956.45 ➔ 07966→	<b>71-33666-00</b> 0348.C8  <b>71-35728-00</b> 4x 0348.L3 	<b>71-34443-00</b> 0349.F4 ➔ 07664 <b>71-35768-00</b> 0349.H0 ➔ 07665→ 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00 N</b> 2x 0236.44 36x50x7 A SL RD FPM
2,0 RFW (XU10J2U)	80 kW (109 PS) JUMPER JUMPER Bus	02/94-04/02	<b>02-33650-02</b> ⑫ 0197.T4 +0209.J8 <b>08-25918-04</b> ⑬	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-33663-00</b> 2x 0348.F6  <b>71-33738-00</b> ⑩ 2x 0348.E6 	<b>71-26236-10</b> 4x 0349.70 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> ← 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
2,0 RFX (XU10J2C) RFX (XU10J2C/Z L3)	89-95 kW (121-129 PS) XANTIA ZX	07/92→	<b>02-33650-01</b> ⑫ 0197.G6 +0209.J8 <b>08-25918-04</b> ⑬	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	<b>71-33664-00</b> 0249.71 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x 	<b>71-34361-00</b> 2x 0348.N0 	<b>71-26236-10</b> 4x 0349.70 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM

⑩ Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / junta, carcasa de colector de admisión / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора



CITROEN						
Ltr.						
2,0 RFY (XU10J4/Z)	112 kW (152 PS) XANTIA 16V ZX 16V	07/92-01/98	<b>02-33665-01</b> <sup>12</sup> 0197.C8 +0209.N1 1 → 05/93 <b>02-33660-01</b> <sup>12</sup> 0197.G7 +0209.N0 1 → 06/93 → <b>08-25918-04</b> <sup>13</sup>	<b>61-33665-00</b> 0209.N1 87 Ø 1,35 mm 1 → 05/93  <b>61-33660-00</b> 0209.N0 87,3 Ø 1,35 mm 1 → 06/93 → 	<b>14-32077-01</b> 0204.65 (10x) 0204.72 (10x) 1 → 06/93 →  <b>14-32148-01</b> 0204.72 (10x) 1 → 06/93 → 	
2,0 RGX (XU10J2TE) RGY (XU10J2TE/Z)	104-108 kW (141-147 PS) EVASION Turbo XANTIA Turbo XM Turbo	09/92-04/03	<b>02-26237-02</b> <sup>12</sup> 0197.H3  <b>08-25918-04</b> <sup>13</sup>	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	
2,0 RHK (DW10UTED4)	88 kW (120 PS) C8 JUMPY HDI 120	01/07 →		<b>61-34370-00</b> 0209.AV 86 Ø 1,25 mm 2 MLS <b>61-34370-10</b> 0209.AW 86 Ø 1,3 mm 3 MLS <b>61-34370-20</b> 0209.AX 86 Ø 1,35 mm 4 MLS <b>61-34370-30</b> 0209.AY 86 Ø 1,4 mm 5 MLS 	<b>14-35774-01</b> 0204.A6 (10x) 	

<sup>12</sup> für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehiculos sin aire acondicionado / per veicoli senza aria condizionata /  
оснащение / оборудование для автомобилей без кондиционера

<b>71-33668-00</b> 0249.74 	<b>12-26058-03</b> 0956.19 (16x) <b>70-26058-00</b> 0956.19 16x	<b>71-33666-00</b> 0348.C8 	<b>71-33667-00</b> 0349.98 	<b>70-31414-10</b> 	<b>81-25926-10 K ←</b> 0326.12 42x62x8 A RD FPM <b>81-34456-00 K →</b> 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-33676-00</b> 0348.E0 → 07664  <b>71-34361-00</b> 2x 0348.N0 → 07665 → 		<b>71-25918-30</b> <sup>28</sup> 0304.34 	<b>81-25926-10 K ←</b> 0326.12 42x62x8 A RD FPM <b>81-34456-00 K →</b> 0127.28 90x110x7 A SL LD FPM <b>81-22660-00 N</b> 0236.24 32x45x7 A LD FPM <b>81-34403-00 N</b> 0236.44 36x50x7 A SL RD FPM
<b>15-36571-01</b> 0348.S3 	<b>12-36588-01</b> 0956.48 (16x) <b>70-36588-00</b> 0956.48 16x		<b>71-36124-00</b> 0349.L9 	<b>70-31414-10</b> 	<b>81-36557-00 K ←</b> 0127.47 42x62x7 A SL RD PTFE <b>81-36556-00 K →</b> 0127.45 90x110x7 A SL LD PTFE <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM



CITROEN						
Ltr.						
2,0 RHM (DW10ATED4) RHT (DW10ATED4) RHW (DW10ATED4)	79-80 kW (107-109 PS) C8 HDI EVASION HDI	09/99→	 <b>01-34404-01</b> 12 0197.Y6  <b>02-34404-01</b> 13 0197.Y7 +0249.A6	<b>61-34370-00</b> 0209.AV 86 Ø 1,25 mm 2 MLS <b>61-34370-10</b> 0209.AW 86 Ø 1,3 mm 3 MLS <b>61-34370-20</b> 0209.AX 86 Ø 1,35 mm 4 MLS <b>61-34370-30</b> 0209.AY 86 Ø 1,4 mm 5 MLS	<b>14-32233-01</b> 0204.96 (10x) 	
2,0 RLZ (EW10D)	103 kW (140 PS) C5 16V C5 16V HPI	03/01-08/04	 <b>01-35045-02</b> 12 0197.Y1 +0209.Z3 +0249.A8 +0249.A7 (4x)  <b>02-35045-02</b> 13 <b>08-37006-01</b> 13 	<b>61-35045-00</b> 0209.Z3 85 Ø MLS 	<b>14-32234-01</b> 0204.A7 (10x) 	
2,0 R6A	94 kW (130 PS) XM	05/89-06/94	 <b>02-33650-01</b> 12 0197.G6 +0209.J8 1 → 03/94  <b>08-25918-04</b> 13	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	
2,0 XU10J2	81 kW (110 PS) JUMPER JUMPER Bus	02/03→	 <b>02-33650-02</b> 12 0197.T4 +0209.J8  <b>08-25918-04</b> 13	<b>61-33650-00</b> 0209.J8 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	

⑫ Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / junta, carcasa de colector de admisión / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора

<b>71-34404-00</b> 0249.A6 	<b>12-34399-02</b> 0956.48 (16x) <b>70-34399-00</b> 0956.48 16x		<b>71-33223-00</b> 0349.J2 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM
<b>71-36967-00</b> 0249.A8 	<b>12-34439-01</b> 0956.45 (16x) <b>70-34439-00</b> 0956.45 16x		<b>71-33853-00</b> 0349.H8 	<b>70-31414-10</b> 	<b>81-34454-00 K</b> ← 0326.27 40x55x6,5 A SL RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00 N</b> 0236.44 36x50x7 A SL RD FPM <b>81-36966-00 N</b> 0236.65 39x50x7 A SL RD FPM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-31379-10</b> 0349.91 	<b>71-26236-10</b> 0349.70 	4x <b>71-25918-30</b> 28 0304.34 1 → 09/93 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-26244-10 N</b> 0236.21 36x50x8 A RD ACM
<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-33663-00</b> 0348.F6 2x  <b>71-33738-00</b> 10 2x 0348.E6 	<b>71-26236-10</b> 0349.70 	4x <b>71-25918-30</b> 28 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00 N</b> 0236.44 36x50x7 A SL RD FPM

⑳ für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehículos sin aire acondicionado / per veicoli senza aria condizionata / оснащение / оборудование для автомобилей без кондиционера



CITROEN						
Ltr.						
2,0 XU102C (R2A)	84 kW (114 PS) XM	05/89-04/94	<b>02-33665-01</b> ⑫ 0197.C8 +0209.N1 <b>08-25918-04</b> ⑬	<b>61-33665-00</b> 0209.N1 87 Ø 1,35 mm 	<b>14-32077-01</b> 0204.65 (10x) 	
2,0 170A (XN1T) 170B (XN1T) 170C (XN1T)	58-62 kW (79-84 PS) C25 C25 Bus	09/81-03/94	<b>02-19231-01</b> ⑫  <b>02-22770-10</b> ⑫	<b>61-22770-40</b> 90 Ø 1,2 mm 		
2,1 PHZ (XUD11ATE) PJZ (XUD11ATE) P8A (XUD11ATE) P8C (XUD11BTE)	80 kW (109 PS) EVASION TD XANTIA TD 12V XM TD 12V	05/89-07/02	<b>01-33673-01</b> ⑫ ⑬  <b>02-33673-01</b> ⑫ 0197.H1  <b>08-25918-03</b> ⑬	<b>61-33655-00</b> 0209.R4 86 Ø 1,52 mm MLS <b>61-33655-10</b> 0209.R5 86 Ø 1,57 mm MLS <b>61-33655-20</b> 0209.R6 86 Ø 1,62 mm MLS <b>61-33655-30</b> 0209.R7 86 Ø 1,67 mm MLS <b>61-33655-40</b> 0209.R8 86 Ø 1,72 mm MLS <b>61-33655-50</b> 0209.T4 86 Ø 1,77 mm 5 □ MLS <b>61-33655-60</b> 0209.T6 86 Ø 1,35 mm 3 □ MLS 	<b>14-32158-01</b> 0204.68 (10x) 	

<b>71-26237-00</b> 0249.48 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x	<b>71-33676-00</b> 0348.E0 	<b>71-26236-10</b> 0349.70 4x 	<b>71-25918-30</b> ⑳ 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM
<b>71-19231-00</b> 0249.14 	<b>12-25837-01</b> 0956.22 (8x) <b>70-25837-00</b> 0956.22 8x		<b>71-17538-10</b> 0349.03 	<b>71-12921-20</b> 0304.44 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30 N</b> 0236.14 35x50x8 A SL WD ACM
<b>71-33673-00</b> 0249.70 	<b>12-25837-03</b> 0956.22 (12x) <b>70-25837-00</b> 0956.22 12x	<b>71-33671-00</b> 0348.96 	<b>71-33672-00</b> 0349.76 	<b>71-25918-30</b> 0304.34 	

⑳ für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehiculos sin aire acondicionado / per veicoli senza aria condizionata / оснащение / оборудование для автомобилей без кондиционера



CITROEN												
Ltr.												
2,1 P9A (XUD11A)	60 kW (82 PS) XM XM D 12V	05/89-08/96		<b>02-33673-01</b> ⑫ 0197.H1  <b>08-25918-03</b> ⑬	<b>61-27540-00</b> 0209.H1 87 Ø 1,5 mm 1 <b>61-27540-10</b> 0209.99 87 Ø 1,6 mm 2 <b>61-27540-20</b> 0209.A0 87 Ø 1,7 mm 3 <b>61-27540-30</b> 0209.H3 87 Ø 1,8 mm 4 	<b>14-32085-01</b> 0204.67 (10x) 	<b>71-33673-00</b> 0249.70 	<b>12-25837-03</b> 0956.22 (12x) <b>70-25837-00</b> 0956.22 12x	<b>71-33671-00</b> 0348.96 	<b>71-33672-00</b> 0349.76 	<b>71-25918-30</b> 0304.34 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-21798-30 N</b> 2x 0236.14 35x50x8 A SL WD ACM
2,2 DW12TED	74 kW (101 PS) JUMPER Bus HDI JUMPER HDI	04/02→		<b>01-34398-01</b> ⑫ ⑬ 0197.X4   <b>02-34398-01</b> ⑫ 0197.X3 	<b>61-33875-00</b> 0209.AQ 86 Ø 1,25 mm 1 MLS <b>61-33875-10</b> 0209.AR 86 Ø 1,3 mm 2 MLS <b>61-33875-20</b> 0209.AS 86 Ø 1,35 mm 3 MLS <b>61-33875-30</b> 0209.AT 86 Ø 1,4 mm 4 	<b>14-32233-01</b> 0204.96 (10x) 	<b>71-34398-00</b> 0249.99 	<b>12-34399-01</b> 0956.48 (8x) <b>70-34399-00</b> 0956.48 8x	<b>71-34401-00</b> 0348.N4 	<b>71-33223-00</b> 0349.J2 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM
2,2 DW12TED4 (4HX) 4HW (DW12TED4) 4HX (DW12TED4)	94-98 kW (128-133 PS) C5 HDI C8 HDI	03/01→		<b>01-34404-01</b> ⑫ ⑬ 0197.Y6   <b>02-34404-01</b> ⑫ 0197.Y7 +0249.A6 	<b>61-34370-00</b> 0209.AV 86 Ø 1,25 mm 2 MLS <b>61-34370-10</b> 0209.AW 86 Ø 1,3 mm 3 MLS <b>61-34370-20</b> 0209.AX 86 Ø 1,35 mm 4 MLS <b>61-34370-30</b> 0209.AY 86 Ø 1,4 mm 5 	<b>14-35774-01</b> 0204.A6 (10x) 	<b>71-34404-00</b> 0249.A6 	<b>12-34399-02</b> 0956.48 (16x) <b>70-34399-00</b> 0956.48 16x	<b>71-33223-00</b> 0349.J2 	<b>70-31414-10</b> 	<b>81-25926-10 K</b> ← 0326.12 42x62x8 A RD FPM <b>81-34456-00 K</b> → 0127.28 90x110x7 A SL LD FPM <b>81-34144-00 N</b> 0807.28 27x47x7 A SL RD FPM	



CITROEN											
2,2 3FZ (EW12J4)	116 kW (158 PS) C8	07/02→	<p><b>01-33025-01</b> <sup>12</sup> <sup>13</sup> 0197.Y8 +0209.0H +0249.A4 +0249.A5 <b>02-33025-01</b> <sup>12</sup></p>	<p><b>61-33025-00</b> 0209.0H 87 Ø MLS </p>	<p><b>14-32235-01</b> 0204.95 (10x) </p>	<p><b>71-34452-00</b> R 0249.A5 </p>	<p><b>12-34439-01</b> 0956.45 (16x) <b>70-34439-00</b> 0956.45 16x</p>	<p><b>71-33018-00</b> 0348.P6 </p>	<p><b>71-33853-00</b> 0349.H8 </p>	<p><b>70-31414-10</b> </p>	<p><b>81-34454-00</b> K ← 0326.27 40x55x6,5 A SL RD FPM <b>81-34456-00</b> K → 0127.28 90x110x7 A SL LD FPM <b>81-34403-00</b> N 0236.44 36x50x7 A SL RD FPM <b>81-36966-00</b> N 0236.65 39x50x7 A SL RD FPM</p>
2,2 4HT (DW12BTE4)	125 kW (170 PS) C5 HDI C6 HDI C8	04/06→	<p><b>02-39244-01</b> <sup>12</sup>  <b>08-39246-01</b> <sup>13</sup></p>	<p><b>61-35805-00</b> 0209.EJ 85,9 Ø 1,25 mm 1 </p> <p><b>61-35805-10</b> 0209.EK 85,9 Ø 1,3 mm 2 </p> <p><b>61-35805-20</b> 0209.EL 85,9 Ø 1,35 mm 3 </p> <p><b>61-35805-30</b> 0209.EN 85,9 Ø 1,4 mm 4 </p>	<p><b>14-35774-01</b> 0204.A6 (10x) </p>	<p><b>15-38554-01</b> 0249.E4 +0249.E5 (2x) +0249.E3  <b>71-38552-00</b> 2x 0249.E5 ACM  <b>71-38554-00</b> 0249.E4 ACM </p>	<p><b>12-38539-01</b> 0956.58 (16x) <b>70-38539-00</b> 0956.58 16x</p>	<p><b>11-38553-01</b> 0348.T2 </p>	<p><b>71-35919-00</b> 0349.L7 </p>	<p><b>70-31414-10</b> </p>	<p><b>81-36557-00</b> K ← 0127.47 42x62x7 A SL RD PTFE <b>81-36556-00</b> K → 0127.45 90x110x7 A SL LD PTFE <b>81-34144-00</b> N 0807.28 27x47x7 A SL RD FPM</p>
2,2 4HU 4HV	74-88 kW (101-120 PS) JUMPER HDI 100 JUMPER HDI 120	04/06→	<p><b>02-35115-03</b> <sup>12</sup>  <b>08-35536-01</b> <sup>13</sup> <sup>99</sup></p>	<p><b>61-37365-00</b> 0209.EH 87,5 Ø 1,1 mm 1 </p> <p><b>61-37365-10</b> 0209.ES 87,5 Ø 1,15 mm 2 </p> <p><b>61-37365-20</b> 0209.ET 87,5 Ø 1,2 mm 3 </p>	<p><b>14-32341-01</b> 0204.C0 (10x) +0204.A9 (8x) </p>	<p><b>71-35115-00</b> 0249.E9 </p>	<p><b>12-35549-01</b> 0956.59 (16x) <b>70-35549-00</b> 0956.59 16x</p>	<p><b>71-35539-00</b> 8x 0348.T1 </p>	<p><b>71-36016-00</b> 0349.L5 </p>	<p><b>15-35536-01</b> </p> <p><b>70-31414-10</b> </p>	<p><b>81-90014-00</b> K ←  0514.C6 PTFE <b>81-90013-00</b> K →  0514.C4 PTFE</p>
2,5 CRD93L (U25-661) M25-629 M25-659 M25-660	54-100 kW (73-136 PS) CX 25 D CX 25 TRI CX 2500 D C25 Bus D C25 D	02/78-02/94	<p><b>02-24960-03</b>  <b>02-24960-04</b> 0197.K1 +0209.L5</p>	<p><b>61-24960-10</b> 0209.L5 95,5 Ø 1,5 mm </p>	<p><b>14-32080-01</b> 0204.41 (8x) +0204.42 (9x) </p>	<p><b>71-31131-00</b> 5 450 155 </p>	<p><b>12-23062-01</b> 5 403 212 (8x) <b>70-23062-00</b> 5 403 212 8x</p>	<p><b>50-92221-20</b> 4x 0348.H0 </p>	<p><b>71-25639-10</b> 4x 0349.F0 </p>		

Ⓜ enthält integr. Wedi / including integrated oil seal / comprend bague d'étanchéité intégr. / contiene retén integrado / contiene paraolio albero motore integrato / содержит встроенное уплотнение вала



CITROEN						
Ltr.						
2,5 CRD93LS (U25-673) M25-648 M25-669	70-88 kW (95-120 PS)	CX 25 TD CX 2500 TD C25 Bus TD C25 DT	04/83-02/94	<b>02-24960-02</b> ⑫  <b>02-27015-01</b> ⑫ 0197.R9 +95 636 687	<b>61-27015-10</b> 0209.L6 95.5 Ø 1,7 mm 	<b>14-32080-01</b> 0204.41 (8x) +0204.42 (9x) 
2,5 M25-662 M25-666 M25-667	115-122 kW (156-168 PS)	CX 25 GTI Turbo	06/84→		<b>61-25730-00</b> 96 18 348 180 94,5 Ø 1,3 mm 	
2,5 THX (DJ5TED)	79 kW (107 PS)	JUMPER Bus TDI JUMPER TDI	12/96-04/02	<b>01-34110-01</b> ⑫ ⑬ ⑭ 0197.W4 +0209.T5  <b>02-34110-01</b> ⑫ 0197.W3 +0209.T5 	<b>61-34110-00</b> 0209.T5 93 Ø 1,35 mm MLS 	<b>14-32156-01</b> 0204.87 (14x) +0204.88 (8x) 
2,5 THY (DK5ATE) THZ T8A (DJ5T) T9A (DJ5)	63-95 kW (86-129 PS)	JUMPER Bus D JUMPER Bus TD JUMPER D JUMPER TD XM TD	03/94→	<b>01-29160-01</b> ⑫ ⑬ 0197.T7 +0209.R3 <b>02-29160-01</b> ⑫ 0197.T6 +0209.R3	<b>61-29160-00</b> 0209.R3 93 Ø 1,6 mm 	<b>14-32164-01</b> 0204.74 (14x) +0204.75 (8x) 

<b>71-25612-20</b> 0249.78 	<b>12-23062-01</b> 5 403 212 (8x) <b>70-23062-00</b> 5 403 212 8x	<b>50-92221-20</b> 0348.H0 4x 	<b>71-25639-10</b> 0349.F0 4x 		<b>81-33859-00</b> K ← 0514.32 75x90x11,5 A SL RD ACM FPM
<b>71-33723-00</b> 0249.79 	<b>12-26058-02</b> 0956.19 (8x) <b>70-26058-00</b> 0956.19 8x	<b>71-37096-00</b> 0348.K4 2x 	<b>71-37097-00</b> 0349.G4 	<b>70-31414-10</b> 	<b>81-34457-00</b> K ← 0326.25 64x88x6 A SL RD ACM FPM <b>81-34458-00</b> K → 0119.14 98x120x7 A SL LD ACM FPM <b>81-17110-20</b> N V 0514.15 35x50x7 A SL RD FPM <b>81-17110-20</b> N H 0807.26 32x52x7 A SL LD ACM FPM
<b>71-33723-00</b> 0249.79 	<b>12-26058-01</b> 0659.19 (12x) <b>70-26058-00</b> 0956.19 12x	<b>71-33687-00</b> 0348.K1 <b>71-33786-00</b> ⑩ 0348.F9 	<b>71-33688-00</b> 0349.E7 	<b>70-31414-10</b> 	<b>81-34457-00</b> K ← 0326.25 64x88x6 A SL RD ACM FPM <b>81-34458-00</b> K → 0119.14 98x120x7 A SL LD ACM FPM <b>81-25451-10</b> N ← 0514.15 35x50x7 A SL RD FPM <b>81-34142-00</b> N → ⑳ 0807.21 47,5x62x7 A SL LD ACM FPM <b>81-34143-00</b> N → ㉑ 0807.15 40x62x7 A SL LD ACM FPM

⑫ Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / junta, carcasa de colector de admisión / guarnizione, alloggiamento collettore aspirazione / прокладка, корпус впускного коллектора

⑬ mit Mehrlagen-Zylinderkopfdichtung / with multilayer cylinder head gasket / avec joint de culasse multifeuilles / con junta de culata MLS / con guarnizione testata multistrato / с многослойной прокладкой головки блока цилиндров

⑭ für Fahrzeuge mit Klimaanlage / for vehicles with air conditioning / pour véhicules avec système de climatisation / para vehículos con aire acondicionado / per veicoli con aria condizionata / оснащение / оборудование для автомобилей с кондиционером

⑩ für Fahrzeuge ohne Klimaanlage / for vehicles without air conditioning / pour véhicules sans système de climatisation / para vehículos sin aire acondicionado / per veicoli senza aria condizionata / оснащение / оборудование для автомобилей без кондиционера

H hinten / rear / arrière / posterior / posteriore / сзади

V vorne / front / avant / delante / anteriore / спереди



CITROEN						
Ltr.						
2,7 DT17ED4 UHZ (DT17BTE4)	150 kW (204 PS) C5 HDI C6 HDI 205 FAP	09/05→ <b>1</b>				
				<b>61-34875-10</b> 2x 0209.CW 82,5 Ø 1,17 mm 2	<b>14-32344-01</b> 2x 0204.A8 (8X) 	
				<b>61-34875-20</b> 2x 0209.CX 82,5 Ø 1,22 mm 3		
				<b>61-34875-30</b> 2x 0209.CY 82,5 Ø 1,27 mm 4		
				<b>61-34875-40</b> 2x 0209.CZ 82,5 Ø 1,32 mm 5		
2,8 F28TDCR	94 kW (128 PS) JUMPER HDI	02/02-06/06		<b>61-33950-00</b> 0209.OC 1,3 mm <b>61-33950-10</b> 0209.OE 1,4 mm <b>61-33950-20</b> 0209.OF 1,5 mm 	<b>14-32096-01</b> 	
2,8 8140.43N	107 kW (146 PS) JUMPER HDI	05/04→	<b>01-33951-10</b> <sup>12</sup> <sup>14</sup> 0197.Y2  <b>02-33951-10</b> <sup>12</sup> 0197.Y3 	<b>61-33950-00</b> 0209.OC 1,3 mm <b>61-33950-10</b> 0209.OE 1,4 mm <b>61-33950-20</b> 0209.OF 1,5 mm 	<b>14-32096-01</b> 	
2,8 8140.43S	93-94 kW (126-128 PS) JUMPER JUMPER Bus HDI JUMPER HDI	09/00→	<b>01-33951-10</b> <sup>12</sup> <sup>14</sup> 0197.Y2  <b>02-33951-10</b> <sup>12</sup> 0197.Y3 	<b>61-33950-00</b> 0209.OC 1,3 mm <b>61-33950-10</b> 0209.OE 1,4 mm <b>61-33950-20</b> 0209.OF 1,5 mm 		

<b>71-38558-00</b> 2x 0249.E1 	<b>12-38546-01</b> 0956.53 (24x) <b>70-38546-00</b> 24x 0956.53		<b>71-34888-00</b> 2x 0349.L0 	<b>71-38527-00</b> 0164.75 	<b>81-34316-00</b> K ← 35x50x7 A SL RD PTFE ACM <b>81-90050-00</b> K → 0514.00 <b>81-38536-00</b> N 2x 0807.36 26x45x8 A SL WD FPM
<b>71-33956-00</b> 0249.C3 	<b>12-34914-05</b> <b>70-34914-00</b> 8x	<b>71-33621-00</b> 4x 	<b>71-33654-00</b> 4x 0349.H5 	<b>71-83048-00</b> 500327440 Kork 	<b>81-90042-00</b> K → 0514.A8 FPM
<b>71-33951-10</b> 0249.A0 	<b>12-34914-05</b> <b>70-34914-00</b> 8x	<b>71-33621-00</b> 4x 	<b>71-33962-00</b> 4x 	<b>71-33944-10</b> Gummi 	
<b>71-33951-10</b> 0249.A0 	<b>12-34914-05</b> <b>70-34914-00</b> 8x	<b>71-33621-00</b> 4x 	<b>71-33654-00</b> 4x 0349.H5 	<b>71-33944-10</b> Gummi 	<b>71-83048-00</b> X 500327440 Kork 

<sup>12</sup> ohne Wellendichtring-Kurbelwelle / without crankshaft oil seal / sans bague d'étanchéité - vilebrequin / sin retén cigüeñal / senza paraolio albero motore / без уплотнительного кольца коленчатого вала



CITROEN						
Ltr.						
3,0 DT20C	177 kW (241 PS) C5 HDI	04/09→				
<b>[NEW]</b>			<b>61-36610-00</b> 2x 0209.GX 85 Ø 1,17 mm 2 MLS <b>61-36610-10</b> 2x 0209.GY 85 Ø 1,22 mm 3 MLS <b>61-36610-20</b> 2x 0209.GZ 85 Ø 1,27 mm 4 MLS <b>61-36610-30</b> 2x 0209.HA 85 Ø 1,32 mm 5 MLS 	<b>14-32344-01</b> 2x 0204.A8 (8x) 		
3,0 ES9J4S XFX (ES9J4S)	152-155 kW (207-211 PS) C5 V6 C6 V6	09/04→	<b>02-36510-01</b> V <b>02-36515-01</b> H <b>02-38556-01</b>  <b>08-34458-01</b> → 10086 <b>08-38528-01</b> → 10087→	<b>61-36510-00</b> L 0209.OX 89 Ø 0,74 mm MLS <b>61-36510-10</b> L 0209.OZ 89 Ø 0,95 mm MLS 		
3,0 SFZ (ZPJ/Z) UFZ (ZPJ/Z)	123 kW (167 PS) XM V6	05/89-10/00	<b>02-33615-02</b> 0197.E1 +0209.A4 +0209.A5 +0956.30 (12x) <b>08-33679-01</b> 	<b>61-36515-00</b> R 0209.OY 89 Ø 0,74 mm MLS <b>61-36515-10</b> R 0209.1A 89 Ø 0,95 mm MLS 	<b>14-32084-01</b> 0204.53 (16x) 	













H hinten / rear / arrière / posterior / posteriore / сзади

















<b>71-38558-00</b> 2x 0249.E1 	<b>12-38546-01</b> 0956.53 (24x) <b>70-38546-00</b> 24x 0956.53		<b>71-34888-00</b> 2x 0349.L0 	<b>71-38527-00</b> 0164.75 	<b>81-38536-00</b> N 0807.36 26x45x8 A SL WD FPM
<b>70-31414-10</b> 	<b>12-31306-05</b> 0956.38 (24x) <b>70-31306-00</b> 24x 0956.38	<b>71-38551-00</b> 0348.00  <b>71-38556-00</b> 2x 0348.P9 	<b>71-38541-00</b> 2x 0349.G0 	<b>70-31414-10</b> 	<b>81-511109-30</b> K ← 0514.82 42x56x7 A SL RD FPM → 10086 <b>81-38529-00</b> K ← 0514.A9 42x56x6,5 A SL RD → 10087→ <b>81-34458-00</b> K → 0119.14 98x120x7 A SL LD ACM FPM → 10086 <b>81-38528-00</b> K → 0119.18 98x120x9 A SL LD → 10087→ <b>81-34146-00</b> N 4x 0807.24 38x50x6 A SL RD FPM
<b>70-31414-10</b> 	<b>12-25837-03</b> 0956.22 (12x) <b>70-25837-00</b> 12x 0956.22	<b>40-76752-00</b> 6x 0348.43 	<b>71-28604-00</b> 6x 96 130 969 	<b>70-31414-10</b> 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-18304-00</b> K → 0514.50 80x100x13 A LD MVQ <b>81-22660-00</b> N 2x 0236.24 32x45x7 A LD FPM

V vorne / front / avant / delante / anteriore / спереди



CITROEN						
Ltr. 						
3,0 SKZ (ZPJ4/Z) UKZ (ZPJ4/Z)	147 kW (200 PS) XM V6 24V	07/90-10/00	<b>02-33615-03</b> <sup>12</sup> 0197.E1 +0209.A4 +0209.A5 +0956.30 (24x) <b>08-33679-01</b> <sup>13</sup> 	<b>61-33615-00</b> R 0209.A4 95,2 ∅ 1,7 mm  <b>61-33620-00</b> L 0209.A5 95,2 ∅ 1,7 mm 	<b>14-32084-01</b> 0204.53 (16x) 	
3,0 XFU (ES9A) XFV (ES9A)	152-155 kW (207-211 PS) C5 C5 V6	09/04→		<b>61-36510-00</b> L 0209.0X 89 ∅ 0,74 mm MLS <b>61-36510-10</b> L 0209.0Z 89 ∅ 0,95 mm MLS  <b>61-36515-00</b> R 0209.0Y 89 ∅ 0,74 mm MLS <b>61-36515-10</b> R 0209.1A 89 ∅ 0,95 mm MLS 		

					
<b>70-31414-10</b> 	<b>12-26058-01</b> 2x 0659.19 (12x) <b>70-26058-00</b> 24x 0956.19	<b>71-33681-00</b> <sup>7</sup> 2x 0349.74 	<b>70-31414-10</b> 	<b>81-25926-10</b> K ← 0326.12 42x62x8 A RD FPM <b>81-18304-00</b> K → 0514.90 80x100x13 A LD MVQ <b>81-22660-00</b> N 2x 0236.24 32x45x7 A LD FPM	
<b>70-31414-10</b> 	<b>12-31306-05</b> 24x 0956.38 (24x) <b>70-31306-00</b> 0956.38	<b>71-38551-00</b> 0348.00  <b>71-38556-00</b> 2x 0348.P9 	<b>71-38541-00</b> 2x 0349.G0 	<b>70-31414-10</b> 	<b>81-38529-00</b> K ← 0514.A9 42x56x6,5 A SL RD <b>81-38528-00</b> K → 0119.18 98x120x9 A SL LD <b>81-38531-00</b> N 4x 0807.34 38x50x7 A SL RD

<sup>7</sup> Dichtung Ansaug-/Abgaskrümmer / intake/exhaust manifold gasket / joint collecteur d'admission/d'échappement / junta para múltiple de admisión/de escape / guarnizione collettore di aspirazione/di scarico / прокладка всасывающего/выпускного колена



CITROEN						
Ltr.						
3,0 XFX (ES9J4S)	150-152 kW (204-207 PS) C5 V6 C8 V6	03/01 →		<b>02-36510-01</b> <sup>12</sup> V <b>02-36515-01</b> <sup>12</sup> H <b>02-38556-01</b> <sup>12</sup>  <b>08-34458-01</b> <sup>13</sup> → 10086 <b>08-38528-01</b> <sup>13</sup> → 10087 →	<b>61-36510-00</b> L 0209.0X 89 Ø 0,74 mm MLS <b>61-36510-10</b> L 0209.0Z 89 Ø 0,95 mm MLS  <b>61-36515-00</b> R 0209.0Y 89 Ø 0,74 mm MLS <b>61-36515-10</b> R 0209.1A 89 Ø 0,95 mm MLS 	
3,0 XFX (ES9J4)	140 kW (190 PS) XANTIA V6 XANTIA 24V XM V6	01/97-04/03		<b>02-36530-01</b> <sup>12</sup> R 0008570 → <b>02-36525-01</b> <sup>12</sup> L 008570 → <b>08-34458-01</b> <sup>13</sup>	<b>61-36525-00</b> L 0209.0N 89 Ø 1,45 mm MLS 0008570 →  <b>61-36530-00</b> R 0209.0P 89 Ø 1,45 mm MLS 0008570 → 	

<sup>12</sup> Dichtung Ansaugkrümmergehäuse / gasket, intake manifold housing / joint d'étanchéité, carter de collecteur d'admission / junta, carcasa de colector de admisión / guarnizione, alloggiam. collettore aspirazione / прокладка, корпус впускного коллектора



	<b>12-31306-05</b> 0956.38 (24x) <b>70-31306-00</b> 0956.38	<b>71-38551-00</b> 0348.00  <b>71-38556-00</b> 2x 0348.P9 	<b>71-38541-00</b> 2x 0349.G0 	<b>70-31414-10</b> 	<b>81-51109-30</b> K ← 0514.82 42x56x7 A SL RD FPM → 10086 <b>81-38529-00</b> K ← 0514.A9 42x56x6,5 A SL RD 10087 → <b>81-34458-00</b> K → 0119.14 98x120x7 A SL LD ACM FPM → 10086 <b>81-38528-00</b> K → 0119.18 98x120x9 A SL LD 10087 → <b>81-34146-00</b> N 4x 0807.24 38x50x6 A SL RD FPM
<b>70-31414-10</b> 	<b>12-31306-05</b> 0956.38 (24x) <b>70-31306-00</b> 0956.38	<b>71-38596-00</b> 2x 0348.L5  <b>71-38594-00</b> <sup>10</sup> 0348.K7 	<b>71-38541-00</b> 2x 0349.G0 	<b>70-31414-10</b> 	<b>81-51109-30</b> K ← 0514.82 42x56x7 A SL RD FPM <b>81-34458-00</b> K → 0119.14 98x120x7 A SL LD ACM FPM <b>81-34146-00</b> N 4x 0807.24 38x50x6 A SL RD FPM

H hinten / rear / arrière / posterior / posteriore / сзади  
 V vorne / front / avant / delante / anteriore / спереди

